

SERVICE INFORMATION

Cust. Serv. - Techn. Dept.
VKT er/lü/wi/fm

-Motorcycle R 69 S, R 50 S
Group: Engine

Munich, 3 June 1964
No. 2/64 (209) en.

re: Flywheel Marke for Sport Motorcycles

Dear Sirs,

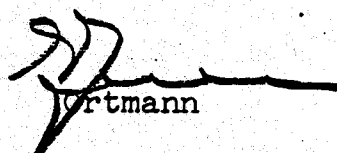
The marks for retarded and advanced ignition of 12° and 42° respectively, before T.D.C. on the flywheel are no longer applicable, since the retarded ignition (initial ignition timing) has been set at 9° before T.D.C..

Commencing with Frame No. 658 164, the flywheel marks on the R 69 S model have been changed to 9° and 39° respectively before T.D.C. Thus the actual flywheel for the S models is now identical with that of the R 50 and R 60 models; the former flywheel-ordering number 00 68.035-is superseded.

With friendly greetings,

BAYERISCHE MOTOREN WERKE
Aktiengesellschaft

i.V.


Kortmann

i.A.


Ansorg